

General Information

Date & Time: 17, Jul, 2026 16:13

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	34,964
Registration No.	NKT8604	Chassis No.	PAHACACA1S6427358
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



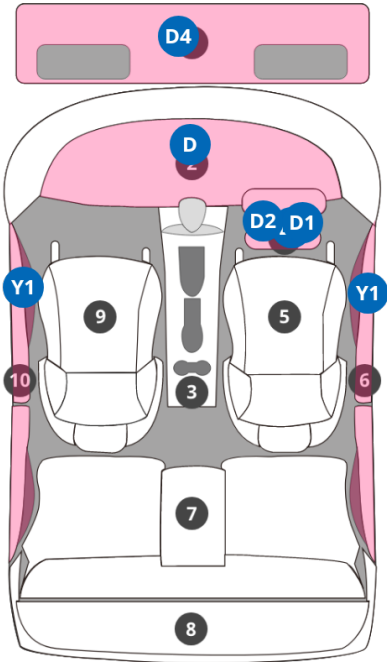
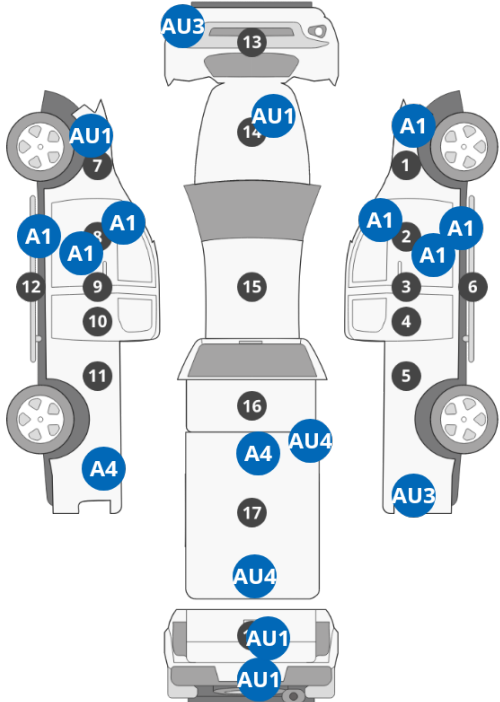
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	110	111	104
2	Boot Lid	49.4	50	54	44
3	Roof	120.0	127	125	113/115
4	Left Front Fender	107.0	107	104	110
5	Left Front Door	105.3	104	106	106
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	67.9	65	70	69
9	Right Front Fender	105.0	113	108	94
10	Right Front Door	105.6	101	109	107
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	68.4	65	70	71

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Large / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (L) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Medium / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Rear Gate - Scratch & Dent - Minimal / (L) Side Gate - Scratch - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights, fuel lid cover missing, battery weak