

General Information

Date & Time: 20, Jul, 2026 14:35

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	19,624
Registration No.	NKP3188	Chassis No.	JTFNAFAP1S8052993
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



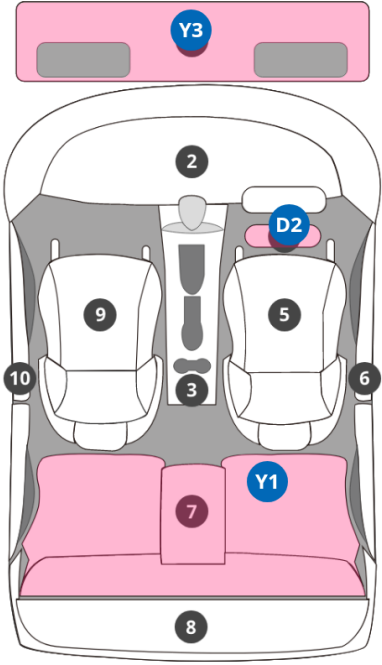
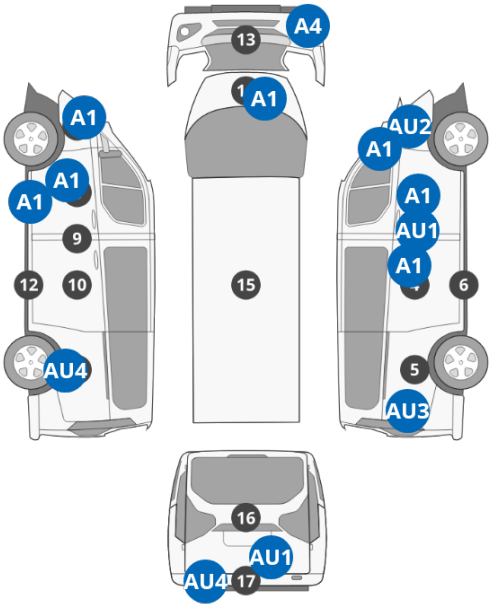
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	114	107	111
2	Boot Lid	103.3	101	102	107
3	Roof	117.2	109	125	119/116
4	Left Front Fender	97.2	90	97	105
5	Left Front Door	100.1	97	102	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	96.2	96	95	97
9	Right Front Fender	95.1	94	100	91
10	Right Front Door	100.1	98	100	103
11	Center Panel Right	112.3	112	117	108
12	Right Rear Door	106.0	108	101	109
13	Right Back Panel	102.4	104	94	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet, 2keys, scratches on headlights