

General Information

Date & Time: 04, Mar, 2025 17:09

Make	Toyota	Model	Vios
YOM	2020	Mileage	102,449
Registration No.	DBA6712	Chassis No.	PA1B18F30L4117441
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



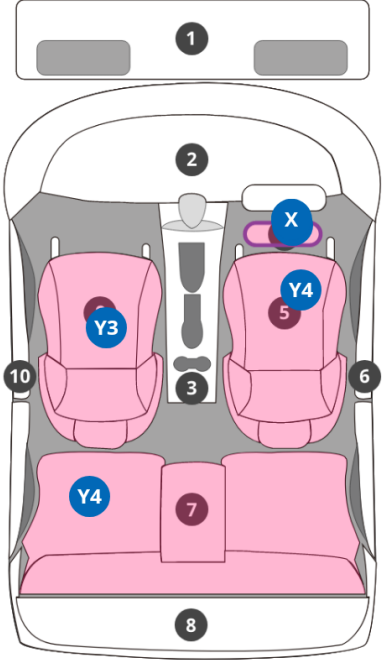
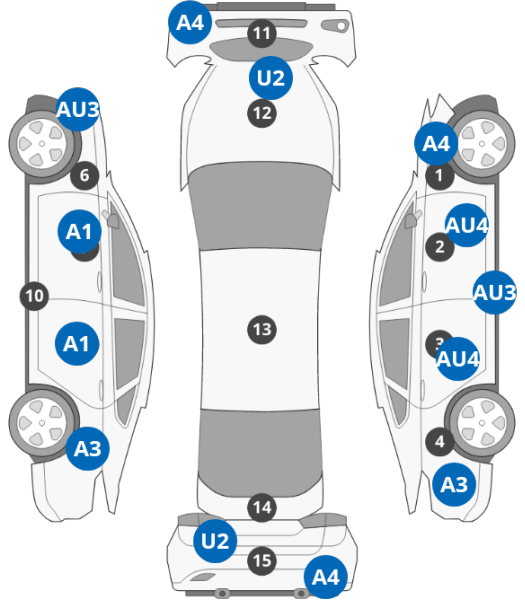
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	130	103	104
2	Boot Lid	102.3	103	101	103
3	Roof	96.5	100	100	97/90
4	Left Front Fender	92.7	91	90	98
5	Left Front Door	96.8	98	99	93
6	Center Panel Left				
7	Left Rear Door	101.6	100	105	100
8	Left Back Panel	103.2	115	102	93
9	Right Front Fender	94.6	96	95	94
10	Right Front Door	96.7	96	95	99
11	Center Panel Right				
12	Right Rear Door	99.4	95	95	109
13	Right Back Panel	100.0	93	96	111

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes	Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Large / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/with jack/with warranty booklet/without tools/right side mirror broken/reverse camera not function