

General Information

Date & Time: 21, Jul, 2026 10:21

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	43,679
Registration No.	FAF4280	Chassis No.	PA1B18F33M4134610
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



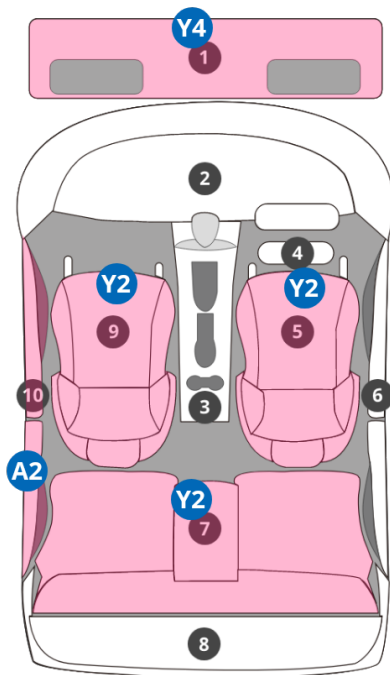
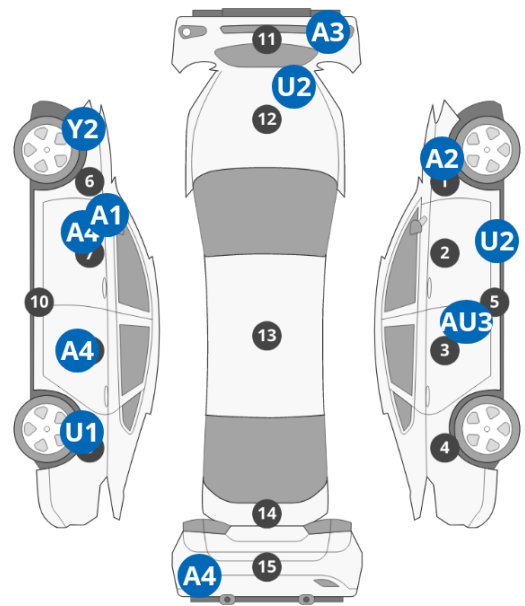
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	123	111	121
2	Boot Lid	112.3	102	102	133
3	Roof	91.2	97	106	79/84
4	Left Front Fender	102.8	110	101	97
5	Left Front Door	91.1	98	88	88
6	Center Panel Left				
7	Left Rear Door	101.4	99	112	94
8	Left Back Panel	98.4	98	98	99
9	Right Front Fender	108.6	106	109	111
10	Right Front Door	87.3	85	86	91
11	Center Panel Right				
12	Right Rear Door	92.7	92	94	93
13	Right Back Panel	92.6	91	89	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Rear Trim - Cut, Crack - Small / (L) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch, Peeled - Minimal / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Crack, Gap - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no lto plates, no warranty booklet, with spare tire, no jack no tools, with hairline scratches in the body,