

General Information

Date & Time: 22, Jul, 2026 07:38

Make	Mitsubishi	Model	Mirage
YOM	2026	Odo Meter Reading	1,054
Registration No.	NLD2733	Chassis No.	PAEA13RXTSA002554
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



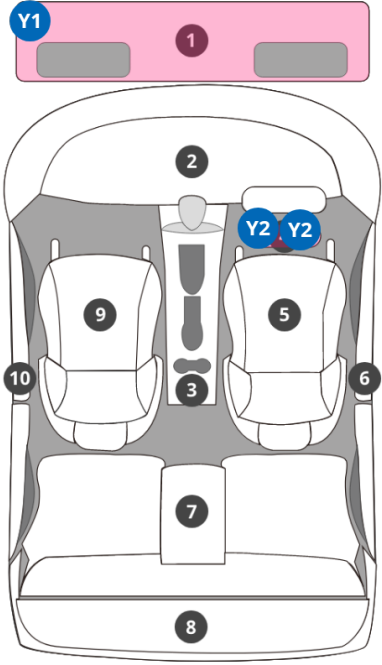
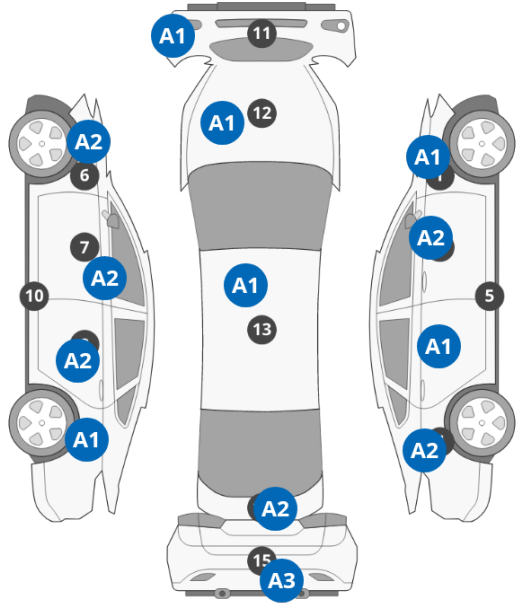
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.6	125	125	127
2	Boot Lid	110.6	115	108	109
3	Roof	112.2	110	115	108/116
4	Left Front Fender	110.3	109	113	109
5	Left Front Door	111.3	115	112	107
6	Center Panel Left				
7	Left Rear Door	118.6	112	117	127
8	Left Back Panel	123.0	116	135	118
9	Right Front Fender	116.3	122	110	117
10	Right Front Door	129.3	139	129	120
11	Center Panel Right				
12	Right Rear Door	119.6	116	117	126
13	Right Back Panel	115.6	112	116	119

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Mat Other - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, minor scratches on taillight